

Clamping nut, hydro-mechanical

maximum power density in the smallest space



ROEMHELD
HILMA ■ STARK

Clamping force indicator pin
(option)



Clamping nut

Tie rod, supplied
separately

Applications:

- for clamping and locking dies on press beds and rams
- on beds of machine tools
- when maximum clamping force is required in the smallest space
- when no power unit is available


Function:

Following manual positioning of the clamping nut against the clamping edge, the integral hydraulic cushion is pre-loaded by turning the hexagon socket. A low torque is translated into a high clamping force.



In the case of versions without clamping force control, use a torque wrench to ensure safe and defined build-up of the clamping force. In the case of versions with clamping force control, the clamping force indicator pin will project by approx. 2.5 mm when the clamping force is reached.

Special features:

- ◇ clamping nut with a through thread, which means high adaptability to varying heights of clamping edges and tolerances.
- ◇ safe clamping using the clamping force indicator pin (option)
- ◇ no need for adaptation of the tie rod length
- ◇ suitable for retrofit
- ◇ intensification of clamping force possible in the case of multiple clamping
- ◇ high clamping force with low torque
- ◇ easy manual clamping and unclamping

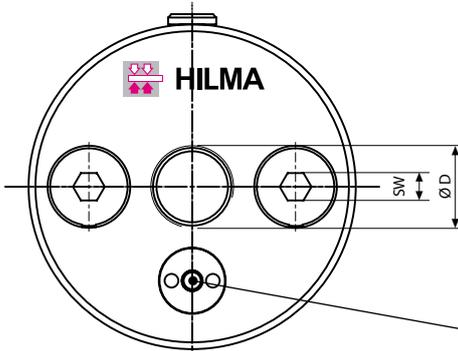

Clamping force indicator pin (option).
Upon reaching of the nominal clamping force the indicator pin will project by 2.5 mm

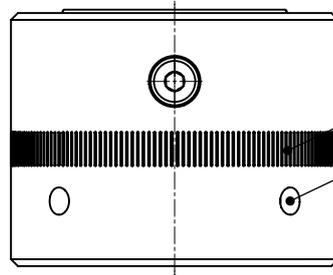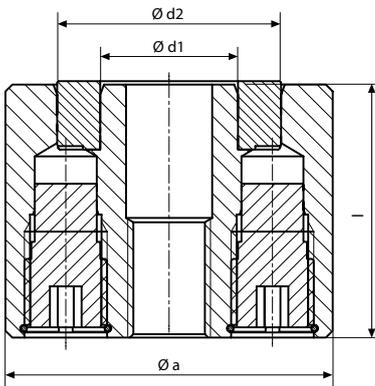

Grooves to give grip

Borehole for preloading the nut using a sickle spanner

Clamping nut, supplied separately

Clamping force (kN)	60	100	150
Max. stroke* (mm)	2	2	2
Tightening torque (Nm)	9	30	—
D (mm)	M 20	M 24	M 30
a (mm)	70	95	112
d1 (mm)	30	40	50
d2 (mm)	50	65	80
SW (mm)	8	8	10
l (mm)	71	75	90
Weight (kg)	2,0	3,7	6,1
without clamping force display			
Part no.	8.2275.0001	8.2276.0001	8.2277.0001
with clamping force display**			
Part no.	8.2275.0002	8.2276.0002	8.2277.0002

* Stroke at maximum adjustment of pressure screws. Preload the nut using a sickle spanner before operating the pressure screws.

** Supplied including Allen key, no torque wrench is required.

Permissible temperature variation: ±20°C

T-bolt, supplied separately

For T-slot (mm)	22	28	36
Thread	M 20	M 24	M 30
Length (mm)	200	250	250
Property class	8.8	8.8	8.8
Part no.	5700023	5700024	5700048